Manifold Valve

SPLIT MANIFOLD VALVE

Spring Loaded Style

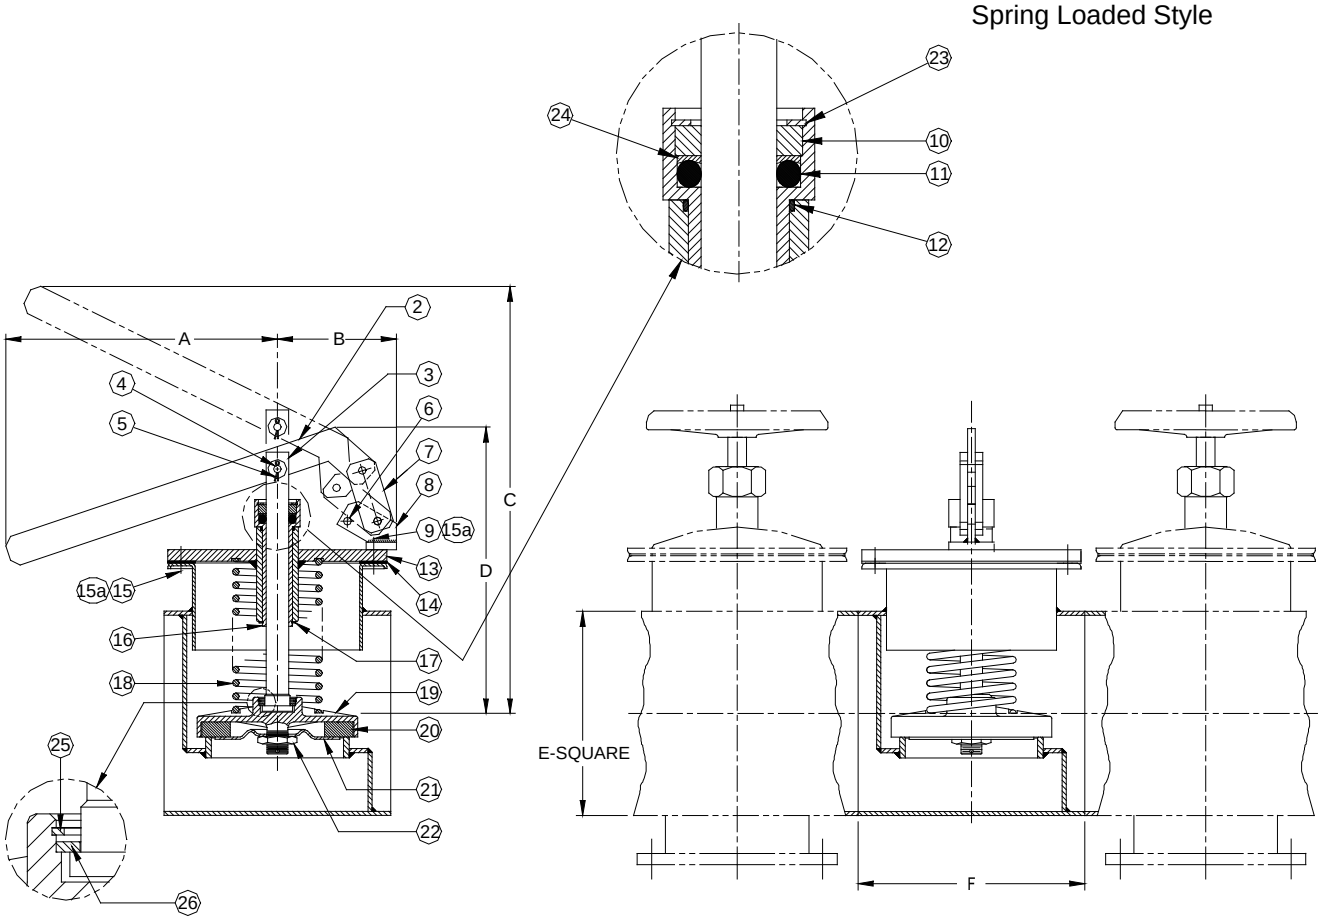

Size	Material	Non-Pressure Manifold Assembly No.	Dimensions					
			A	B	C	D	E	F
4"	Steel	SML504MSB	$9\frac{3}{8}$	$3\frac{7}{8}$	$14\frac{1}{4}$	9	$6\frac{3}{4}$	$7\frac{1}{2}$
	Aluminum	SML504ALB						

WARNING
Manifold valves shall not be installed where compliance with NFPA385 2-7 is required.

NOTES:
1. Split manifold valves are standard with buna-N discs, cork/buna-N gasket and Viton stem seal.
2. See section 5, page 3A (front of this page) for standard split manifold valve.

PARTS LIST

No.	Description	Req'd.	Material	Part No.
2	Lever	1	Steel "E" Coated	26541EY
3	Washer ¼	3	Steel	9Q5850
4	Clevis Pin ¼x1	3	Steel	9Q4189
5	Cotter Pin 3/32x¾	3	Brass	9Q5865
6	Stop Pin ¼x1¼	1	Steel	9Q8594
7	Link	2	Steel "E" Coated	17399EY
8	Link Support	1	Steel "E" Coated	17400EY
9	Bolts ¼-28x1¼	2	Steel Zinc Plt.	9Q4173
10	Wiper-Scraper	1	Br. & Bn.	17397BR
11	O-Ring	1	Viton	19483VT
12	O-Ring	1	Buna	17945BN
13	Tophead & Bonnet	1	Aluminum	26481AL
14	Tophead Gasket	1	Cork-Bn.	15265CB

No.	Description	Req'd.	Material	Part No.
15	Bolts ¼-28x1	14	Steel Zinc Plt.	9Q5824
15a	Hex Locknut ¼-28	16	Steel Zinc Plt.	9Q5807
16	Bushing	1	Brass	17395BR
17	Snap Ring	1	Steel	9Q5945
18	Spring	1	Steel "E" Coated	17171EY
19	Disc Holder & Stem Assy.	1	Alum./Stnls.	27113AS
20	Disc	1	Buna-N	15024BU
21	Disc Retaining Plate	1	Aluminum	15051AL
22	Disc Plate Nut	1	Stainless 316	15204SS
23	Retaining Ring	1	Steel	9Q4968
24	Teflon Back-up Ring	2	Teflon	19484TF
25	Retaining Ring	1	Steel	9Q4963
26	Stem Retainer	1	Aluminum	19729AL

NOTE: For complete replacement sub-assembly (Items 2-24) order Part No. WV18156MSB.

WARNING Use only genuine BETTS INDUSTRIES INC. replacement parts. Use of substitute parts can impair the proper functioning of this product.